



SERVICE BULLETIN

Classification: BT09-079	Reference: NTB10-010	Date: January 19, 2010
-----------------------------	-------------------------	---------------------------

2009 370Z; SEAT POPPING NOISE/SLIGHT MOVEMENT FROM FRONT RIGHT SEAT CORNER

APPLIED VEHICLE: 2009 370Z (Z34) Left Side Manual Seat **ONLY**
APPLIED VIN/DATE: Vehicles built before JN1AZ44(**)9M 410159 / 26-Jun-2009

IF YOU CONFIRM

A popping-type noise and/or slight movement from the right front seat bottom seat cushion during turns:

ACTION

Remove the Seat Cushion Frame from the seat.

Replace the push-type star washers of the frame as shown in the Service Procedure of this bulletin.

NOTE: Do not replace the entire Seat Cushion Frame of the seat for this incident, if it should occur.

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Rpl Front Seat Lifter Star Washer	87182-1EA1A	VX2JAA	ZL	46	0.7

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
NUT-PUSH (push-type star washer)	87182-1EA1A	2

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove Seat Cushion Frame from the vehicle. Refer to **section SE, SEAT Disassembly and Assembly** in the 2009 370Z Electronic Service Manual.

NOTE: Both the inner side AND outer side star washer being replaced in this procedure is shown below.

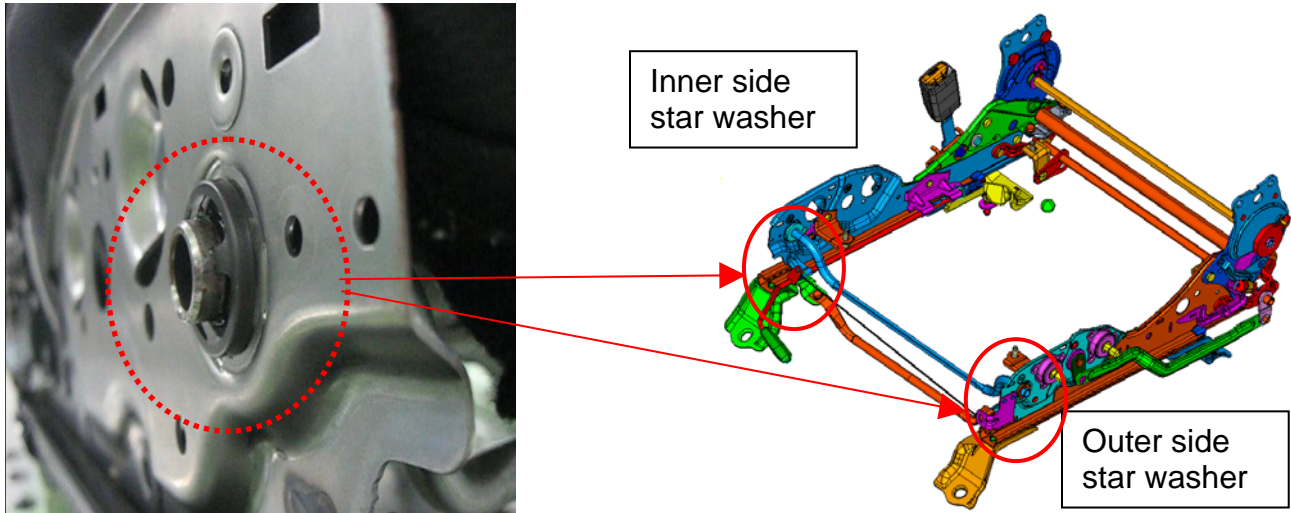


Figure 1

3. Remove the original star washer from the inner side of frame with cutters or small flat-head screwdriver.



Figure 3

4a. Locate a pipe, socket, or similar tool with an internal dimension (ID) between 20 to 21mm that can be used as a drift. Ensure size is such that it does not interfere with “legs” of star washer (see Figure 4).

4b. Use tool to drive new star washer onto connector bar.

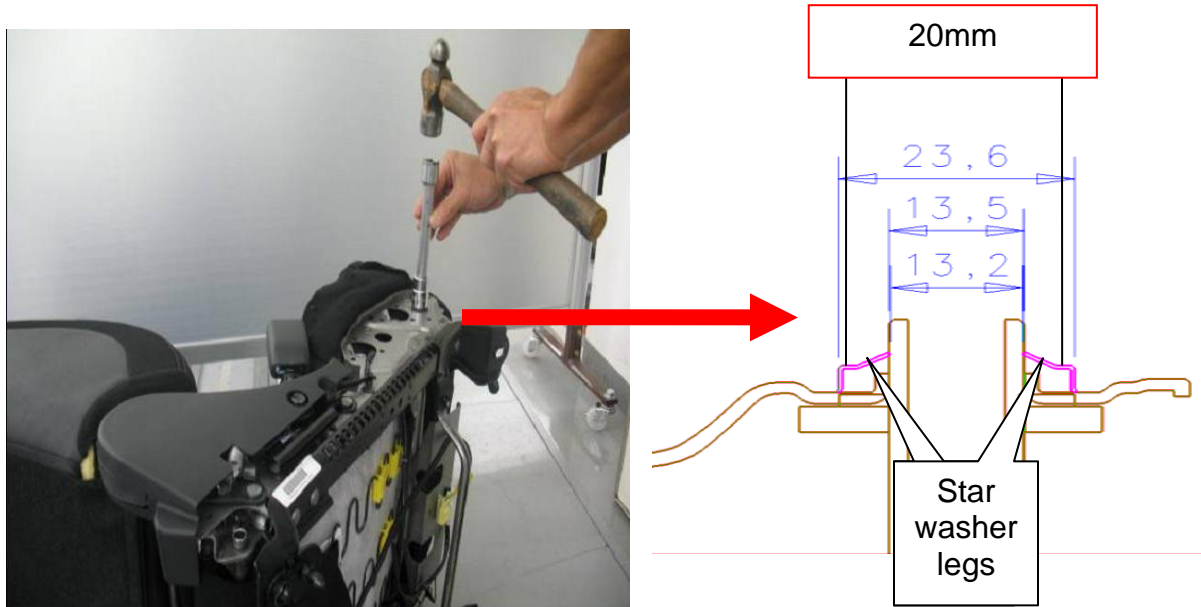


Figure 4

5. After drifting ensure star washer is fully seated against seat frame.

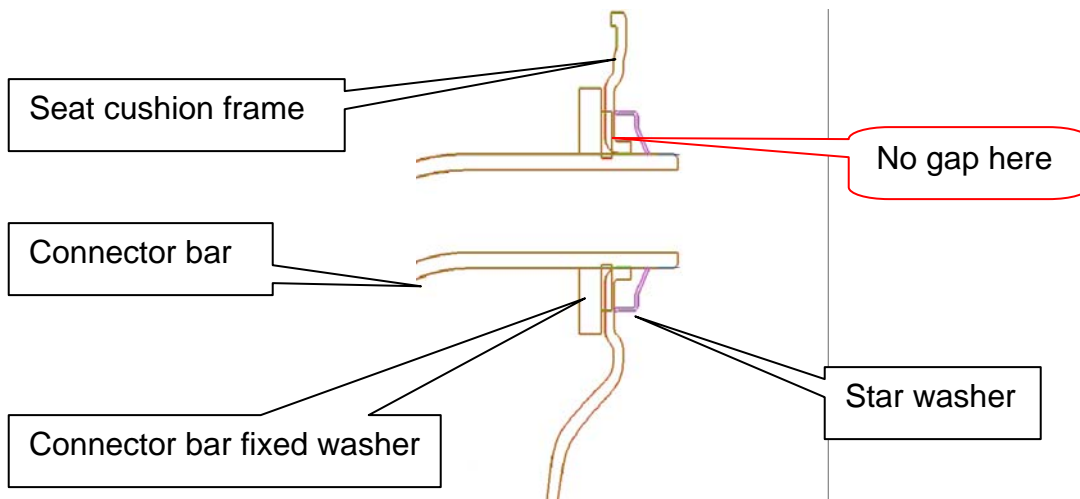


Figure 5

6. Perform steps 3 through 5 for the outer star washer.

7. Re-assemble vehicle in reverse order of disassembly.