



SERVICE BULLETIN

Classification: EL09-014	Reference: NTB09-036	Date: April 27, 2009
-----------------------------	-------------------------	-------------------------

IPDM SERVICE


APPLIED VEHICLES: 2007 - 2009 Nissan Models with IPDM

SERVICE INFORMATION

The Intelligent Power Distribution Module (IPDM) is **ONLY** serviceable as an assembly.

The **ONLY** serviceable parts of an IPDM are the fuses.

- Some IPDM designs have sections that appear to be serviceable relays.
- These “relays” are **NEVER** to be removed.
- These “relays” may have markings indicating they are similar. They are not “swappable”.

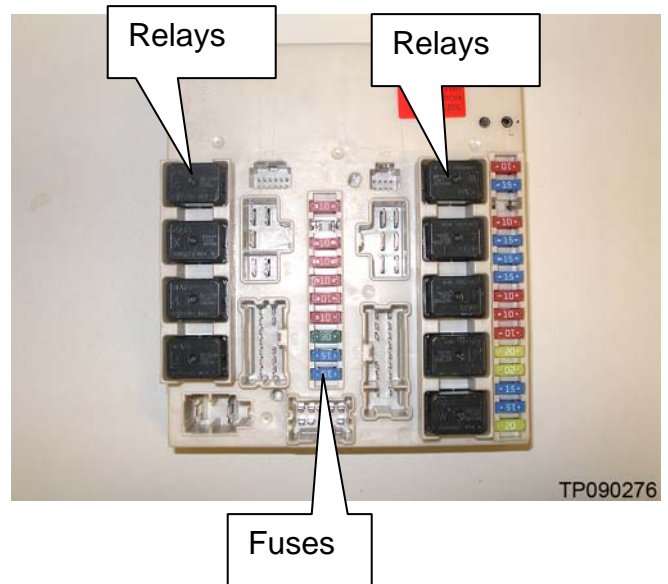

CAUTION:

NEVER REMOVE relays from an IPDM.

Tampering with the relays of an IPDM may cause additional incidents with the vehicle. Such incidents may include:

- Headlights inoperative.
- Radiator fan inoperative
- Fog lamps inoperative
- Wiper inoperative

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.