



# SERVICE BULLETIN

Classification: RS11-004	Reference: NTB12-004	Date: January 9, 2012
-----------------------------	-------------------------	--------------------------

## SUPPLEMENTAL RESTRAINT SYSTEM (SRS) FRONT DOOR SIDE SATELLITE SENSOR INTRODUCTION

**APPLIED VEHICLES:** All 2011-2012 Nissan vehicles with SRS DTC B1338 and/or B1345 logic

### SERVICE INFORMATION

The Applied Vehicles now come equipped with a “Front Door Side Satellite Sensor”, in addition to the pre-existing Side Air Bag Satellite Sensor found in the pillar.

These Sensors have new Diagnostic Trouble Codes (DTC) associated with them.


**IMPORTANT:** If the front door internals are being serviced for any reason, and this Sensor is unplugged or reconnected with the ignition ON, **the following codes could be stored:**

- B1338 and/or B1345 - SATELITE SENSOR LH or RH.

And

- The code(s) is a “PAST” code **only**.

**NOTE:** When diagnosing the DTCs listed above, be aware of this potential sequence of events.

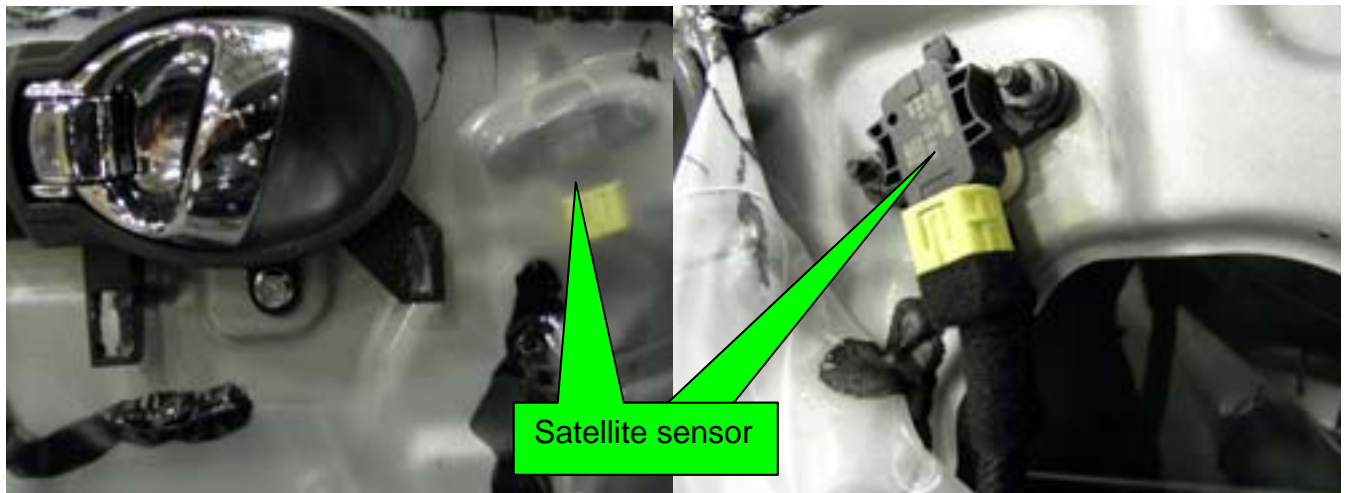

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.